
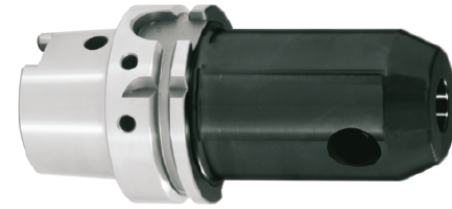


"Weldon" Type End Mill Holder DIN 1835-B

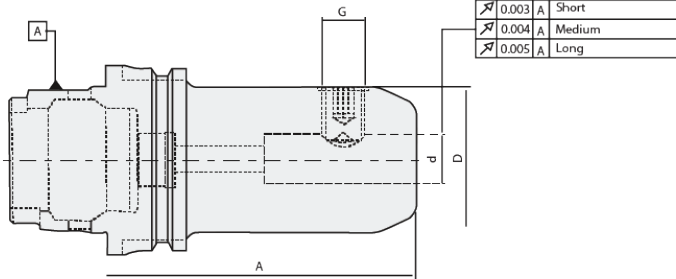


Fine balanced holders

Balanced for G6.3 @ 8,000 rpm

Taper Size	Specification	d	D	A	G	Coolant Supply	Kg
HSK- A50	EMH-HSK-A50-16-80	16	48	80	M14	Form "AD"	0.7
	EMH-HSK-A50-20-80	20	52	80	M16	Form "AD"	0.1
HSK- A63	EMH-HSK-A63-06-65	6	25	65	M6	Form "AD"	1.0
	EMH-HSK-A63-08-65	8	28	65	M8	Form "AD"	1.0
	EMH-HSK-A63-10-65	10	35	65	M10	Form "AD"	1.0
	EMH-HSK-A63-12-80	12	42	80	M12	Form "AD"	1.4
	EMH-HSK-A63-16-80	16	48	80	M14	Form "AD"	1.4
	EMH-HSK-A63-18-80	18	50	80	M14	Form "AD"	1.7
	EMH-HSK-A63-20-80	20	52	80	M16	Form "AD"	1.7
	EMH-HSK-A63-06-100	6	25	100	M6	Form "AD"	1.18
	EMH-HSK-A63-08-100	8	28	100	M8	Form "AD"	1.18
	EMH-HSK-A63-10-100	10	35	100	M10	Form "AD"	1.18
	EMH-HSK-A63-12-100	12	42	100	M12	Form "AD"	1.5
	EMH-HSK-A63-16-100	16	48	100	M14	Form "AD"	1.7
	EMH-HSK-A63-20-110	20	60	110	M16	Form "AD"	2.2
	EMH-HSK-A63-25-110	25	65	110	M18	Form "AD"	2.5
	EMH-HSK-A63-32-110	32	72	110	M20	Form "AD"	2.5
	EMH-HSK-A63-40-125	40	80	160	M20	Form "AD"	3.2
	HSK- A100	EMH-HSK-A100-12-80	12	42	80	M12	Form "AD"
EMH-HSK-A100-16-100		16	48	100	M14	Form "AD"	2.8
EMH-HSK-A100-20-100		20	52	100	M16	Form "AD"	3.2
EMH-HSK-A100-25-100		25	65	100	M18	Form "AD"	3.7
EMH-HSK-A100-32-100		32	72	100	M20	Form "AD"	4.0
	EMH-HSK-A100-40-105	40	80	105	M20	Form "AD"	4.7

- Please order coolant tube separately
- Includes : Locking screw
- G2.5 @ 15,000 rpm on request

Spare Parts & Accessories



Locking Screw